

SERVICE BULLETIN

AFTERSALES SERVICE OFFICE, MITSUBISHI MOTORS CORPORATION

PURPOSE: INFORMATION	ISSUE NO.: MSB-08E23-004	DATE: 2008-06-05	
SUBJECT: LOW CLUTCH PRESSURE SWITCH AND 3-5 REVERSE CLUTCH PRESSURE SWITCH		<model> (EUR/RUSSIA) OUTLANDER</model>	<m y=""> 07–08</m>
GROUP : AUTOMATIC TRA	ANSMISSION	(GS45X)(CW0W)	

1. Description:

The low clutch pressure switch and 3-5 reverse clutch pressure switch in the valve body assembly for the 6-speed automatic transmission have been abolished. This Service Bulletin contains the modified descriptions.

2. Applicable Manuals:

<EUR>

Manual	Pub. No.	Title (Info-ID)	Attachment
2008 OUTLANDER Workshop Manual	CGXE08E2-CD (English) CGXS08E2-CD (Spanish) CGXF08E2-CD (French) CGXG08E2-CD (German)	Check Chart for Diagnosis Codes (M1231007900783) Transmission Assembly Removal and Installation (M1231005701292)	Attachment 1

<RUSSIA>

Underneath Manual	Underneath Pub. No.	Title (Info-ID)	Attachment
2007 OUTLANDER Workshop Manual	N/A	Check Chart for Diagnosis Codes (M1231007900749) Transmission Assembly Removal and Installation (M1231005701225)	Attachment 1

1

3. Effective Date:

From late October 2007

4. Details:

Attachment 1

Due to the following change, the service procedures have been established.

- 1.The low clutch pressure switch and 3-5 reverse clutch pressure switch in the valve body assembly have been abolished.
- 2. Due to the change as described above, A/T-ECU has been changed.

SERVICE PROCEDURES

(1) The following DTCs have been abolished.

DTC No.	Diagnostic items	
P0841	Low clutch pressure switch system	
P0871	3-5 reverse clutch pressure switch system	

(2) The following attention is added when the transmission assembly is replaced.

A CAUTION

Replace the A/T-ECU simultaneously when the old transmission assembly is replaced with a new one. The new-and-old compatibility between the transmission assembly and A/T-ECU is indicated as follows.

		A/T-ECU	
		New	Old
Transmission assembly	New	0	×
	Old	0	0