



SERVICE BULLETIN

AFTERSALES SERVICE OFFICE, MITSUBISHI MOTORS CORPORATION

PURPOSE : INFORMATION	ISSUE NO. : MSB-08E22-002	DATE : 2008-06-20
SUBJECT : REMOVAL SERVICE POINT OF GEARSHIFT CABLE/ SELECT CABLE CONNECTION	<MODEL> <M/Y>	
GROUP : MANUAL TRANSMISSION	(EUR/RUSSIA) See following <u>2. Applicable Manuals table.</u>	

1. Description:

In accordance with the establishment of a special tool (MB992277) for manual transmission vehicles, the removal service point is added for the gearshift cable connection (transmission side) and select cable connection (both the transmission and gearshift lever sides). In addition, the installation service point of the select cable connection (gearshift lever side) is also added. This Service Bulletin contains the added service points.

2. Applicable Manuals:

See Attachments 1 and 2.

<EUR>

Manual/Model	<M/Y>	Pub. No.	Title (Info-ID)	Attachment
2008 LANCER EVOLUTION Workshop Manual (Japanese Domestic Spec.) (GS41EVO)(CZ4A)	08	DRAFT	Special Tool (M1221000601065), Transmission Control Removal and Installation (M1221003801043)	Attachment 3
2009 LANCER EVOLUTION Workshop Manual (GS41EVO)(CZ4A)	09	CGEE09E1-CD (English) CGES09E1-CD (Spanish) CGEF09E1-CD (French) CGEG09E1-CD (German)	Special Tool (M1221000601084), Transmission Control Removal and Installation (M12210038041139)	
2008 LANCER Workshop Manual (GS41)(CY0A)	08	CG1E08E2-CD (English) CG1S08E2-CD (Spanish) CG1F08E2-CD (French) CG1G08E2-CD (German)	Special Tool (M1221000601051), Transmission Control Removal and Installation (M122100381117)	Attachment 4
2008 OUTLANDER Workshop Manual (GS45X)(CW0W)	08	CGXE08E2-CD (English) CGXS08E2-CD (Spanish) CGXF08E2-CD (French) CGXG08E2-CD (German)	Special Tool (M1221000600973), Transmission Control Removal and Installation (M1221003801021)	
2007 OUTLANDER Workshop Manual (GS45X)(CW0W)	07	CGXE07E1-CD (English) CGXS07E1-CD (Spanish) CGXF07E1-CD (French) CGXG07E1-CD (German)	Special Tool (M1221000600898), Transmission Control Removal and Installation (M1221003800921)	
2005–2007 COLT, COLT CZ3/CZT Workshop Manual CD-ROM (ZM24,ZM44X)(Z30A)	05–07	CZME07E1CD (English) CZMS07E1CD (Spanish) CZMF07E1CD (French) CZMG07E1CD (German)	Special Tool (M1221000600768), Transmission Control Removal and Installation (M1221003800727)	Attachment 5
2008 COLT Workshop Manual CD-ROM (ZM44X)(Z30A)	08	CZME08E1CD (English) CZMS08E1CD (Spanish) CZMF08E1CD (French) CZMG08E1CD (German)		


<RUSSIA>

Underneath Manual/Model	<M/Y>	Underneath Pub. No.	Title (Info-ID)	Attachment
2008 LANCER Workshop Manual (GS41)(CY0A)	08	N/A	Special Tool. (M1221000601051), Transmission Control Removal And Installation (M1221003801117)	Attachment 4
2007 OUTLANDER Workshop Manual (GS45X)(CW0W)	07	N/A	Special Tool. (M1221000600898), Transmission Control Removal and Installation (M1221003800921)	

3. Details:


Attachment 3

REMOVAL AND INSTALLATION SERVICE PROCEDURE OF SELECT CABLE CONNECTION

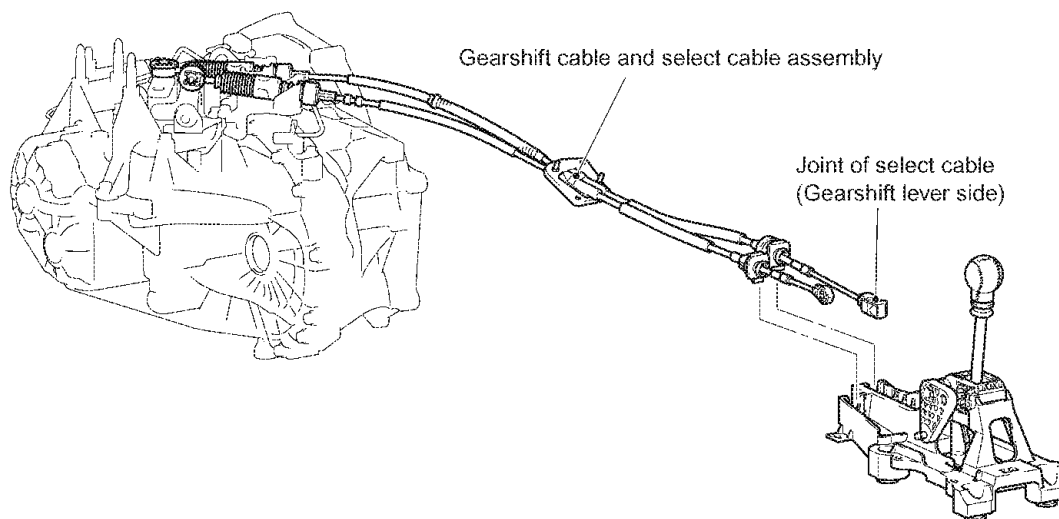

REMOVAL SERVICE POINT OF SELECT CABLE CONNECTION (GEARSHIFT LEVER SIDE)


CAUTION

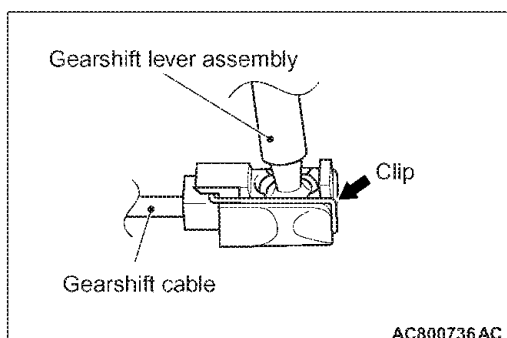

When removing the gearshift cable, be careful not to deform it because the clip is opened forcibly.


INSTALLATION SERVICE POINT OF SELECT CABLE CONNECTION (GEARSHIFT LEVER SIDE)

CAUTION

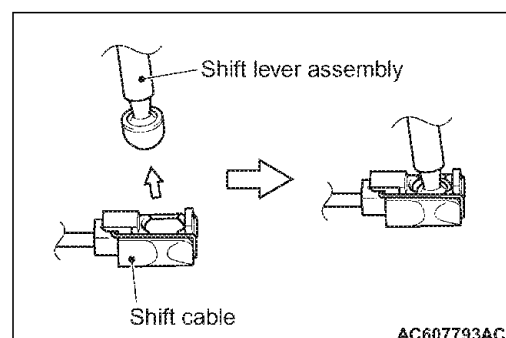


After the installation, slightly pull the joint to down direction to check that it is connected securely.

REMOVAL AND INSTALLATION SERVICE PROCEDURE OF GEARSHIFT CABLE / SELECT CABLE CONNECTION

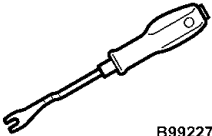Tool	Number	Name	Use
 B992277	MB992277	Clip remover	Gearshift cable / select cable assembly joint disconnection

<F5MGA>


Joint of gearshift cable/ select cable (Transmission side)

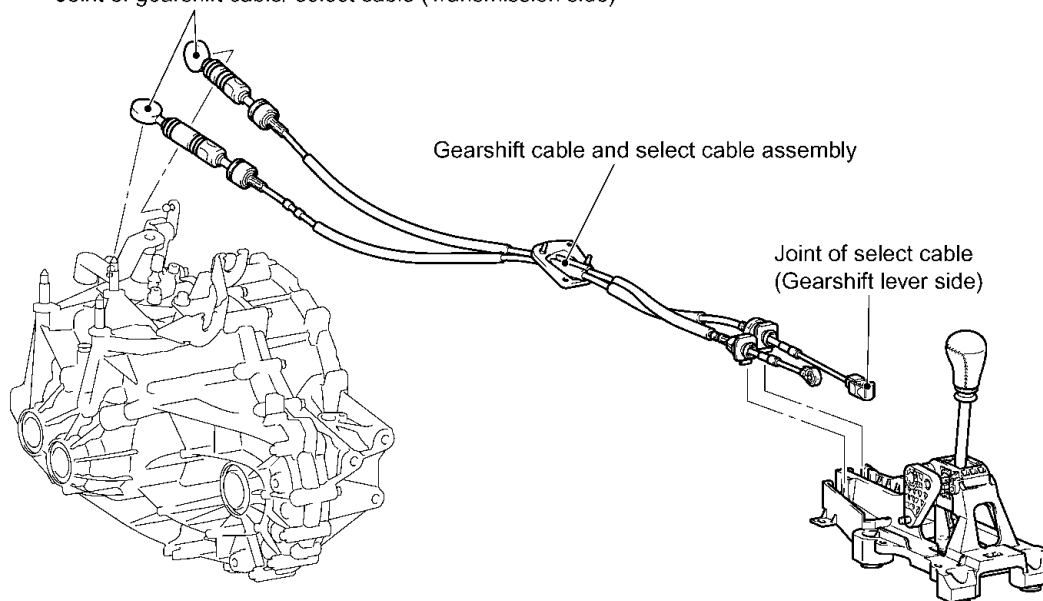

AC801215AD


<F5MBB/W5MBB>

Joint of gearshift cable/ select cable (Transmission side)

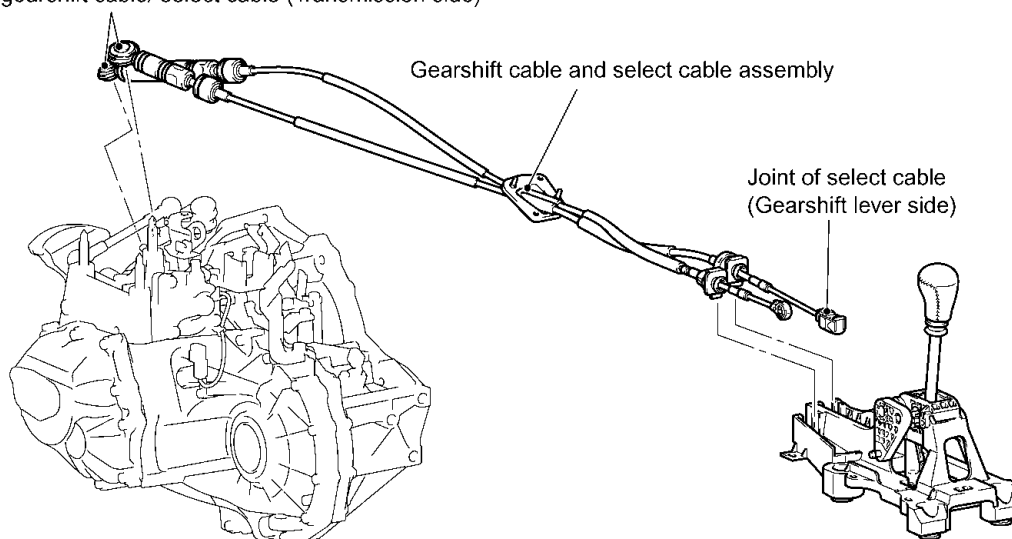

AC801134AD


<F6MBB>

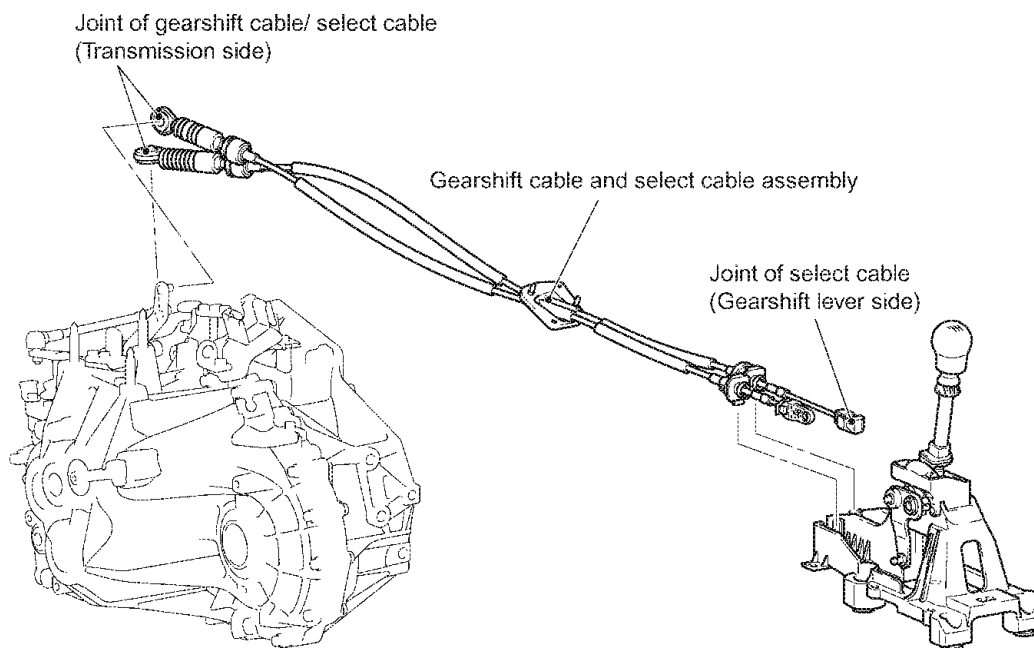

AC801207AB

REMOVAL SERVICE POINT OF GEARSHIFT CABLE /SELECT CABLE CONNECTION (TRANSMISSION SIDE)

CAUTION

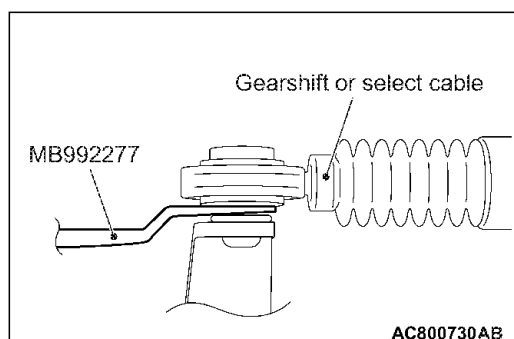


AC800730AB

Be careful not to pull out the cable directly to disconnect the joint because the cable could be broken.

Use the clip remover (special tool: MB992277), and disconnect the joint.

REMOVAL SERVICE POINT OF SELECT CABLE CONNECTION (GEARSHIFT LEVER SIDE)

CAUTION

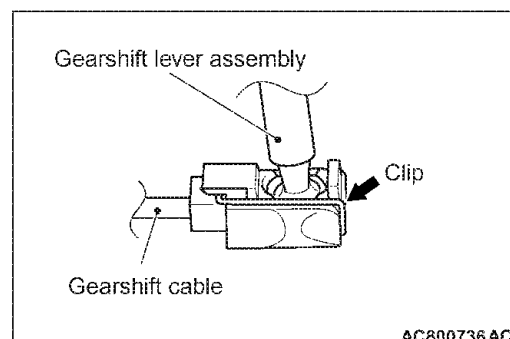


AC800736AC

When removing the gearshift cable, be careful not to deform it because the clip is opened forcibly.


INSTALLATION SERVICE POINT OF SELECT CABLE CONNECTION (GEARSHIFT LEVER SIDE)

⚠ CAUTION

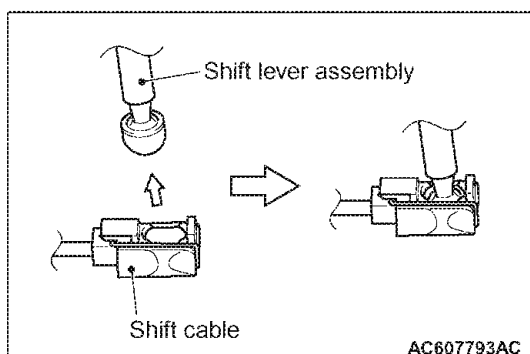


After the installation, slightly pull the joint to down direction to check that it is connected securely.

REMOVAL SERVICE PROCEDURE OF GEARSHIFT CABLE / SELECT CABLE CONNECTION

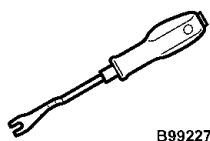
Tool	Number	Name	Use
 B992277	MB992277	Clip remover	Gearshift cable / select cable assembly joint disconnection

Joint of gearshift cable/ select cable (Transmission side)

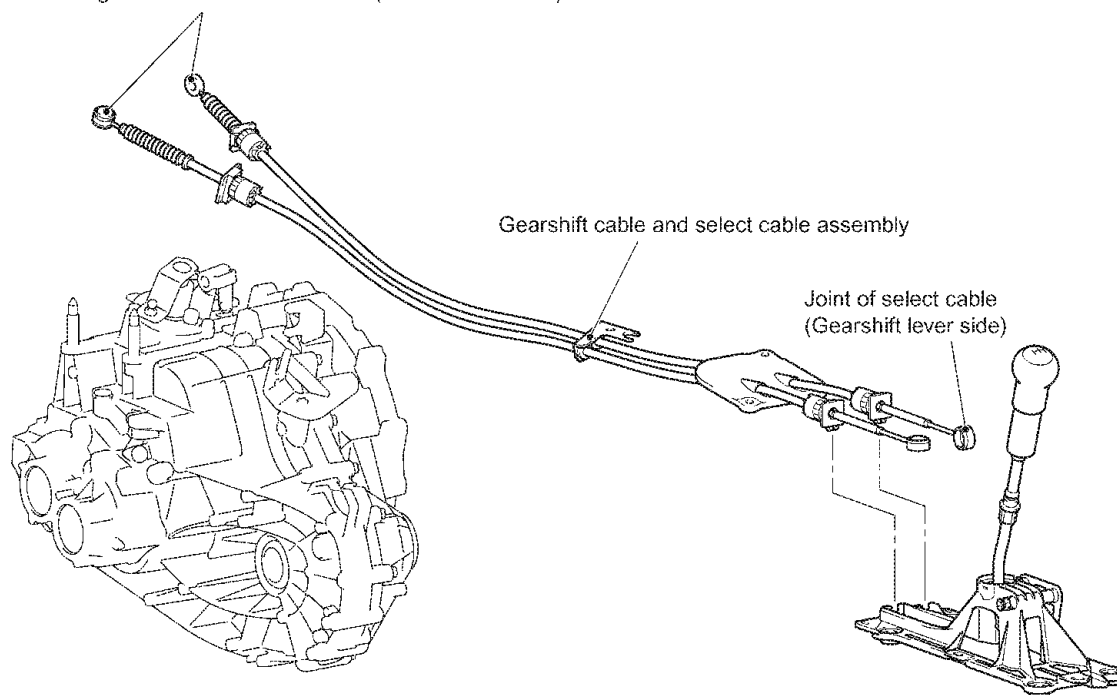

AC801201AB

REMOVAL SERVICE POINT OF GEARSHIFT CABLE /SELECT CABLE CONNECTION (TRANSMISSION SIDE)

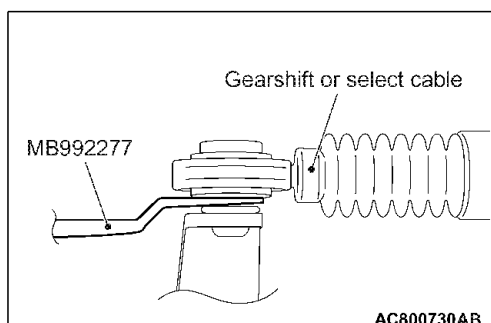
⚠ CAUTION

AC800730AB

Be careful not to pull out the cable directly to disconnect the joint because the cable could be broken.

Use the clip remover (special tool: MB992277), and disconnect the joint.

REMOVAL SERVICE POINT OF SELECT CABLE CONNECTION (GEARSHIFT LEVER SIDE)

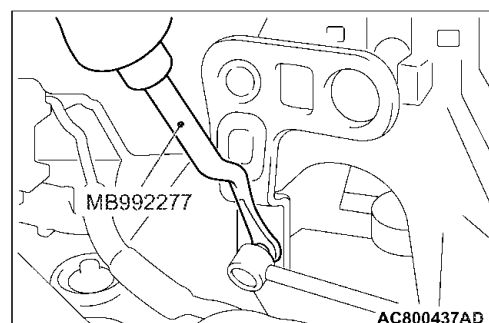⚠ CAUTION

AC800437AD

Be careful not to pull out the cable directly to disconnect the joint because the cable could be broken.

Use the clip remover (special tool: MB992277), and disconnect the joint.